

Drägerwerk AG & Co. KGaA, 23542 Lübeck, Germany

To our customers with
Dräger Atlan workstations

August 2025

Important safety notice! **Possible failure of the automatic ventilation** **due to impurities in the motor electronics**

This only affects Atlan anaesthesia workstations with serial numbers
according to the attached list.
Other anaesthesia machines are NOT affected!

Dear Sir or Madam,

In the course of our global market surveillance, we have become aware of cases in which the Atlan anaesthesia workstations either indicated a failure of the piston ventilator before use or suffered a failure of the mechanical ventilation during use. There have not been any reports of patient injuries to date.

Our investigations revealed that the cases are due to impurities (dust) that were introduced for a certain time frame during the manufacturing process of the ventilator motor encoder. According to our records, you have received one or more devices from the affected serial number range.

If the error occurs before use, e.g. in standby or system test mode, mechanical ventilation cannot be started. If the error occurs during a procedure, the mechanical ventilation may fail, and the device alerts the user by displaying the "Ventilator failure!!!" message. Manual ventilation or spontaneous breathing remains possible in both cases. It may be necessary to manually ventilate the patient to prevent patient injury. With ongoing alarm of the ventilation failure the Atlan continues to provide the Man/Spon ventilation mode, fresh-gas and agent delivery as well as all monitoring functions without restriction.

Drägerwerk AG & Co. KGaA
Moislinger Allee 53-55
23558 Lübeck, Germany
Postal address:
23542 Lübeck, Germany
Tel. +49 451 882-0
Fax +49 451 882-2080
info@draeger.com
www.draeger.com

Bank details:
Commerzbank AG, Lübeck
IBAN: DE95 2304 0022 0014 6795 00
Swift-Code: COBA DE FF 230

Sparkasse zu Lübeck
IBAN: DE15 2305 0101 0001 0711 17
Swift-Code: NOLADE21SPL

Registered office: Lübeck
Commercial register:
Local court Lübeck HRB 7903 HL
General partner:
Drägerwerk Verwaltungs AG
Registered office: Lübeck
Commercial register:
Local court Lübeck HRB 7395 HL
UID-Nr. DE135082211

Chairman of the Supervisory Board
for Drägerwerk AG & Co. KGaA
and Drägerwerk Verwaltungs AG:
Stefan Lauer

Executive Board:
Stefan Dräger (chairman)
Stefanie Hirsch
Rainer Klug
Gert-Hartwig Lescow
Dr. Reiner Piske
Anton Schrofner

Our Dräger Service will contact you and arrange an appointment for replacing the motor, free of charge.

Until then, please continue operating your devices with the customary care by only using the device under permanent supervision in line with the Atlan instructions for use. If the mechanical ventilation fails, use Man/Spon ventilation mode to ventilate the patient manually as needed.

If necessary, you can downgrade the alarm priority of the "Ventilator failure!!!" alarm with "ALARM RESET".

We regret any inconveniences this may cause.

Please ensure that all users of the Dräger Atlan as well as other persons concerned within your organization are made aware of this Important Safety Notice. Please complete and return the attached reply card to confirm this.

If you have made the products available to third parties, please forward a copy of this Important Safety Notice to them.

Please store this Important Safety Notice at least until the motor has been replaced.

The responsible authorities have been notified of this action.

Identification of affected medical devices:

According to our records, you have received at least one Atlan anaesthesia workstation manufactured by Drägerwerk AG & Co. KGaA (European Single Registration Number: DE-MF-000005329) that may be affected by this issue.

Contact:

If you have any questions, please do not hesitate to contact your local Dräger representative. We apologise for any inconvenience this measure may cause.

Yours faithfully,

Makoto Onda

Makoto Onda
Product Management
Business Unit Therapy

Sonja Hillmer

Sonja Hillmer
Post Market Surveillance
Quality and Regulatory Affairs

Attachment to Important Safety Notice – list of affected devices

Device	Part number	Basic UDI DI
Atlan A100	8621100	040486751301035FK19X030W4
Atlan A100 XL	8621200	
Atlan A300	8621300	040486751301035FK19Z00OW9
Atlan A300 XL	8621400	
Atlan A350	8621500	040486751301035FK19T010V2
Atlan A350 XL	8621600	

UDIs for Atlan A100

(01)4048675594963(11)250204(21)ASUA-0333(93)8621100-08	(01)4048675594963(11)250404(21)ASUC-0335(93)8621100-09
(01)4048675594963(11)250204(21)ASUA-0334(93)8621100-08	(01)4048675594963(11)250404(21)ASUC-0336(93)8621100-09
(01)4048675594963(11)250204(21)ASUA-0336(93)8621100-08	(01)4048675594963(11)250411(21)ASUD-0045(93)8621100-09
(01)4048675594963(11)250210(21)ASUA-0457(93)8621100-08	(01)4048675594963(11)250422(21)ASUD-0148(93)8621100-09
(01)4048675594963(11)250220(21)ASUB-0166(93)8621100-08	(01)4048675594963(11)250425(21)ASUD-0218(93)8621100-09
(01)4048675594963(11)250320(21)ASUC-0002(93)8621100-09	(01)4048675594963(11)250425(21)ASUD-0229(93)8621100-09
(01)4048675594963(11)250320(21)ASUC-0003(93)8621100-09	(01)4048675594963(11)250425(21)ASUD-0230(93)8621100-09
(01)4048675594963(11)250401(21)ASUC-0260(93)8621100-09	(01)4048675594963(11)250425(21)ASUD-0231(93)8621100-09
(01)4048675594963(11)250401(21)ASUC-0261(93)8621100-09	(01)4048675594963(11)250428(21)ASUD-0240(93)8621100-09
(01)4048675594963(11)250402(21)ASUC-0280(93)8621100-09	(01)4048675594963(11)250428(21)ASUD-0241(93)8621100-09
(01)4048675594963(11)250402(21)ASUC-0281(93)8621100-09	(01)4048675594963(11)250428(21)ASUD-0242(93)8621100-09
(01)4048675594963(11)250402(21)ASUC-0282(93)8621100-09	(01)4048675594963(11)250428(21)ASUD-0243(93)8621100-09
(01)4048675594963(11)250404(21)ASUC-0330(93)8621100-09	(01)4048675594963(11)250429(21)ASUD-0255(93)8621100-09
(01)4048675594963(11)250404(21)ASUC-0333(93)8621100-09	(01)4048675594963(11)250429(21)ASUD-0256(93)8621100-09
(01)4048675594963(11)250404(21)ASUC-0334(93)8621100-09	(01)4048675594963(11)250429(21)ASUD-0257(93)8621100-09

UDIs for Atlan A100 XL

(01)4048675594956(11)250214(21)ASUB-0079(93)8621200-08	(01)4048675594956(11)250401(21)ASUC-0258(93)8621200-09
(01)4048675594956(11)250214(21)ASUB-0080(93)8621200-08	(01)4048675594956(11)250401(21)ASUC-0259(93)8621200-09
(01)4048675594956(11)250214(21)ASUB-0084(93)8621200-08	(01)4048675594956(11)250417(21)ASUD-0139(93)8621200-09
(01)4048675594956(11)250214(21)ASUB-0085(93)8621200-08	(01)4048675594956(11)250422(21)ASUD-0161(93)8621200-09
(01)4048675594956(11)250214(21)ASUB-0086(93)8621200-08	(01)4048675594956(11)250422(21)ASUD-0162(93)8621200-09
(01)4048675594956(11)250214(21)ASUB-0087(93)8621200-08	(01)4048675594956(11)250422(21)ASUD-0163(93)8621200-09
(01)4048675594956(11)250225(21)ASUB-0212(93)8621200-08	

UDIs for Atlan A300

(01)04048675556343(11)250207(21)ASUA-0431(93)8621300-19	(01)04048675556343(11)250407(21)ASUC-0374(93)8621300-20
(01)04048675556343(11)250210(21)ASUA-0462(93)8621300-19	(01)04048675556343(11)250407(21)ASUC-0375(93)8621300-20
(01)04048675556343(11)250210(21)ASUA-0463(93)8621300-19	(01)04048675556343(11)250408(21)ASUC-0411(93)8621300-20
(01)04048675556343(11)250210(21)ASUA-0464(93)8621300-19	(01)04048675556343(11)250408(21)ASUC-0412(93)8621300-20
(01)04048675556343(11)250210(21)ASUA-0467(93)8621300-19	(01)04048675556343(11)250408(21)ASUC-0413(93)8621300-20
(01)04048675556343(11)250211(21)ASUA-0494(93)8621300-19	(01)04048675556343(11)250408(21)ASUC-0414(93)8621300-20
(01)04048675556343(11)250212(21)ASUB-0019(93)8621300-19	(01)04048675556343(11)250408(21)ASUC-0415(93)8621300-20
(01)04048675556343(11)250213(21)ASUB-0049(93)8621300-19	(01)04048675556343(11)250410(21)ASUD-0040(93)8621300-20
(01)04048675556343(11)250213(21)ASUB-0050(93)8621300-19	(01)04048675556343(11)250417(21)ASUD-0124(93)8621300-20
(01)04048675556343(11)250213(21)ASUB-0051(93)8621300-19	(01)04048675556343(11)250417(21)ASUD-0125(93)8621300-20
(01)04048675556343(11)250213(21)ASUB-0055(93)8621300-19	(01)04048675556343(11)250417(21)ASUD-0132(93)8621300-20
(01)04048675556343(11)250213(21)ASUB-0056(93)8621300-19	(01)04048675556343(11)250422(21)ASUD-0151(93)8621300-20
(01)04048675556343(11)250214(21)ASUB-0057(93)8621300-19	(01)04048675556343(11)250422(21)ASUD-0152(93)8621300-20
(01)04048675556343(11)250214(21)ASUB-0058(93)8621300-19	(01)04048675556343(11)250422(21)ASUD-0153(93)8621300-20
(01)04048675556343(11)250214(21)ASUB-0059(93)8621300-19	(01)04048675556343(11)250422(21)ASUD-0154(93)8621300-20
(01)04048675556343(11)250214(21)ASUB-0071(93)8621300-19	(01)04048675556343(11)250422(21)ASUD-0155(93)8621300-20
(01)04048675556343(11)250214(21)ASUB-0072(93)8621300-19	(01)04048675556343(11)250422(21)ASUD-0156(93)8621300-20
(01)04048675556343(11)250217(21)ASUB-0089(93)8621300-19	(01)04048675556343(11)250423(21)ASUD-0169(93)8621300-20
(01)04048675556343(11)250217(21)ASUB-0090(93)8621300-19	(01)04048675556343(11)250423(21)ASUD-0170(93)8621300-20
(01)04048675556343(11)250217(21)ASUB-0091(93)8621300-19	(01)04048675556343(11)250423(21)ASUD-0171(93)8621300-20

(01)04048675556343(11)250218(21)ASUB-0125(93)8621300-19	(01)04048675556343(11)250423(21)ASUD-0172(93)8621300-20
(01)04048675556343(11)250218(21)ASUB-0126(93)8621300-19	(01)04048675556343(11)250425(21)ASUD-0213(93)8621300-20
(01)04048675556343(11)250218(21)ASUB-0127(93)8621300-19	(01)04048675556343(11)250425(21)ASUD-0214(93)8621300-20
(01)04048675556343(11)250224(21)ASUB-0180(93)8621300-19	(01)04048675556343(11)250425(21)ASUD-0215(93)8621300-20
(01)04048675556343(11)250224(21)ASUB-0181(93)8621300-19	(01)04048675556343(11)250425(21)ASUD-0216(93)8621300-20
(01)04048675556343(11)250224(21)ASUB-0182(93)8621300-19	(01)04048675556343(11)250425(21)ASUD-0217(93)8621300-20
(01)04048675556343(11)250226(21)ASUB-0246(93)8621300-19	(01)04048675556343(11)250428(21)ASUD-0232(93)8621300-20
(01)04048675556343(11)250226(21)ASUB-0247(93)8621300-19	(01)04048675556343(11)250428(21)ASUD-0233(93)8621300-20
(01)04048675556343(11)250226(21)ASUB-0248(93)8621300-19	(01)04048675556343(11)250428(21)ASUD-0234(93)8621300-20
(01)04048675556343(11)250226(21)ASUB-0249(93)8621300-19	(01)04048675556343(11)250428(21)ASUD-0235(93)8621300-20
(01)04048675556343(11)250227(21)ASUB-0289(93)8621300-19	(01)04048675556343(11)250428(21)ASUD-0236(93)8621300-20
(01)04048675556343(11)250227(21)ASUB-0290(93)8621300-19	(01)04048675556343(11)250428(21)ASUD-0237(93)8621300-20
(01)04048675556343(11)250401(21)ASUC-0270(93)8621300-20	(01)04048675556343(11)250429(21)ASUD-0264(93)8621300-20
(01)04048675556343(11)250401(21)ASUC-0271(93)8621300-20	(01)04048675556343(11)250429(21)ASUD-0265(93)8621300-20
(01)04048675556343(11)250403(21)ASUC-0325(93)8621300-20	(01)04048675556343(11)250429(21)ASUD-0266(93)8621300-20
(01)04048675556343(11)250403(21)ASUC-0326(93)8621300-20	(01)04048675556343(11)250430(21)ASUD-0288(93)8621300-20
(01)04048675556343(11)250403(21)ASUC-0327(93)8621300-20	(01)04048675556343(11)250430(21)ASUD-0289(93)8621300-20
(01)04048675556343(11)250404(21)ASUC-0328(93)8621300-20	(01)04048675556343(11)250430(21)ASUD-0290(93)8621300-20
(01)04048675556343(11)250404(21)ASUC-0329(93)8621300-20	(01)04048675556343(11)250430(21)ASUD-0291(93)8621300-20

UDIs for Atlán A300 XL

(01)4048675556169(11)250203(21)ASUA-0307(93)8621400-19	(01)4048675556169(11)250410(21)ASUD-0039(93)8621400-20
(01)4048675556169(11)250207(21)ASUA-0438(93)8621400-19	(01)4048675556169(11)250417(21)ASUD-0123(93)8621400-20

UDIs for Atlan A350

[illegible]

Page 5 / 13

[illegible]

Page 7 / 13

[illegible]

(01)4048675556176(11)250327(21)ASUC-0203(93)8621500-20	(01)4048675556176(11)250429(21)ASUD-0259(93)8621500-20
(01)4048675556176(11)250327(21)ASUC-0204(93)8621500-20	(01)4048675556176(11)250429(21)ASUD-0260(93)8621500-20
(01)4048675556176(11)250327(21)ASUC-0205(93)8621500-20	(01)4048675556176(11)250429(21)ASUD-0261(93)8621500-20
(01)4048675556176(11)250327(21)ASUC-0206(93)8621500-20	(01)4048675556176(11)250429(21)ASUD-0262(93)8621500-20
(01)4048675556176(11)250327(21)ASUC-0207(93)8621500-20	(01)4048675556176(11)250429(21)ASUD-0263(93)8621500-20
(01)4048675556176(11)250327(21)ASUC-0208(93)8621500-20	(01)4048675556176(11)250429(21)ASUD-0267(93)8621500-20
(01)4048675556176(11)250327(21)ASUC-0209(93)8621500-20	(01)4048675556176(11)250430(21)ASUD-0273(93)8621500-20
(01)4048675556176(11)250327(21)ASUC-0210(93)8621500-20	(01)4048675556176(11)250430(21)ASUD-0274(93)8621500-20
(01)4048675556176(11)250328(21)ASUC-0218(93)8621500-20	(01)4048675556176(11)250430(21)ASUD-0281(93)8621500-20
(01)4048675556176(11)250328(21)ASUC-0219(93)8621500-20	(01)4048675556176(11)250430(21)ASUD-0282(93)8621500-20
(01)4048675556176(11)250328(21)ASUC-0220(93)8621500-20	(01)4048675556176(11)250430(21)ASUD-0283(93)8621500-20
(01)4048675556176(11)250328(21)ASUC-0221(93)8621500-20	

UDIs for Atlan A350 XL

[illegible]

[illegible]

(01)4048675556183(11)250326(21)ASUC-0175(93)8621600-20 (01)4048675556183(11)250502(21)ASUD-0294(93)8621600-20

Ventilator kit assembly

Manufacturing month	Serial numbers	
11-2024	ASTM-...	...-1468, ...-1469, ...-1470, ...-1473, ...-1474, ...-1475, ...-1476, ...-1477, ...-1478, ...-1479, ...-1480, ...-1481, ...-1482, ...-1485, ...-1488, ...-1490, ...-1491, ...-1492, ...-1493, ...-1494, ...-1495, ...-1498, ...-1501, ...-1502, ...-1503, ...-1508, ...-1509, ...-1510
01-2025	ASUA-...	...-0384, ...-0389, ...-0538, ...-0539, ...-0540, ...-0541, ...-0542, ...-0543, ...-0544, ...-0545, ...-0546, ...-0547, ...-0548, ...-0549, ...-0550, ...-0551, ...-0552, ...-0554, ...-0555, ...-0557, ...-0562, ...-0584, ...-0595, ...-0596, ...-0597, ...-0598, ...-0599, ...-0600, ...-0601, ...-0602, ...-0603, ...-0604, ...-0605, ...-0606, ...-0607, ...-0608, ...-0609, ...-0610, ...-0611, ...-0613, ...-0614, ...-0627, ...-0629, ...-0630, ...-0631, ...-0632, ...-0633, ...-0638, ...-0640, ...-0641, ...-0642, ...-0646, ...-0649, ...-0653, ...-0694, ...-0708, ...-0712, ...-0713, ...-0714, ...-0715, ...-0716, ...-0717, ...-0718, ...-0719, ...-0720, ...-0721, ...-0722, ...-0723, ...-0724, ...-0725, ...-0726, ...-0727, ...-0728, ...-0729, ...-0730, ...-0731, ...-0732, ...-0733, ...-0734, ...-0735, ...-0736, ...-0737, ...-0738, ...-0739, ...-0740, ...-0741, ...-0742, ...-0743, ...-0744, ...-0745, ...-0746, ...-0747, ...-0748, ...-0749, ...-0750, ...-0751, ...-0752, ...-0753, ...-0754, ...-0755, ...-0756, ...-0757, ...-0759, ...-0761
02-2025	ASUB-...	...-0013, ...-0014, ...-0015, ...-0016, ...-0017, ...-0019, ...-0020, ...-0021, ...-0022, ...-0023, ...-0024, ...-0025, ...-0026, ...-0028, ...-0030, ...-0031, ...-0032, ...-0033, ...-0034, ...-0037, ...-0038, ...-0039, ...-0040, ...-0042, ...-0043, ...-0044, ...-0045, ...-0046, ...-0048, ...-0049, ...-0051, ...-0052, ...-0053, ...-0054, ...-0055, ...-0056, ...-0058, ...-0059, ...-0060, ...-0061, ...-0062, ...-0063, ...-0065, ...-0066, ...-0068, ...-0069, ...-0071, ...-0077, ...-0080, ...-0081, ...-0082, ...-0087, ...-0088, ...-0089, ...-0090, ...-0094, ...-0095, ...-0096, ...-0097, ...-0098, ...-0103, ...-0106, ...-0107, ...-0108, ...-0109, ...-0110, ...-0111, ...-0112, ...-0114, ...-0117, ...-0118, ...-0119, ...-0120, ...-0121, ...-0123, ...-0124, ...-0125, ...-0126, ...-0128, ...-0129, ...-0130, ...-0132, ...-0133, ...-0135, ...-0136, ...-0138, ...-0141, ...-0142, ...-0144, ...-0149, ...-0150, ...-0152, ...-0154, ...-0156, ...-0157, ...-0158, ...-0159, ...-0160, ...-0161
03-2025	ASUC-...	...-0246, ...-0247, ...-0248, ...-0249, ...-0250, ...-0251, ...-0252, ...-0253, ...-0254, ...-0255, ...-0256, ...-0257, ...-0258, ...-0259, ...-0260, ...-0261, ...-0262, ...-0263, ...-0264, ...-0265, ...-0266, ...-0267, ...-0268, ...-0269, ...-0270, ...-0271, ...-0272, ...-0273, ...-0274, ...-0275, ...-0276, ...-0277, ...-0278, ...-0279, ...-0280, ...-0281, ...-0282, ...-0283, ...-0284, ...-0285, ...-0286, ...-0287, ...-0288, ...-0289, ...-0290, ...-0291, ...-0292, ...-0293, ...-0294, ...-0295, ...-0296, ...-0297, ...-0298, ...-0299, ...-0300, ...-0301, ...-0302, ...-0303, ...-0304, ...-0305, ...-0306, ...-0307, ...-0308, ...-0309, ...-0310, ...-0311, ...-0312, ...-0313, ...-0314, ...-0315, ...-0316, ...-0317, ...-0318, ...-0319, ...-0320, ...-0321, ...-0322, ...-0323, ...-0324, ...-0325, ...-0326, ...-0327, ...-0328, ...-0329, ...-0330,

		...-0331, ...-0332, ...-0333, ...-0334, ...-0335, ...-0336, ...-0337, ...-0338, ...-0339, ...-0340, ...-0341,
04-2025	ASUD-...	...-0001, ...-0002, ...-0004, ...-0005, ...-0007, ...-0008, ...-0011, ...-0012, ...-0013, ...-0014, ...-0016, ...-0017, ...-0020, ...-0021, ...-0023, ...-0024, ...-0025, ...-0026, ...-0027, ...-0028, ...-0029, ...-0030, ...-0031, ...-0032, ...-0033, ...-0034, ...-0035, ...-0036, ...-0037, ...-0038, ...-0039, ...-0040, ...-0041, ...-0042, ...-0043, ...-0044, ...-0045, ...-0046, ...-0047, ...-0048, ...-0049, ...-0050, ...-0051, ...-0052, ...-0053, ...-0054, ...-0055, ...-0056, ...-0057, ...-0058, ...-0059, ...-0060, ...-0061, ...-0062, ...-0063, ...-0064, ...-0065, ...-0066, ...-0067, ...-0068, ...-0069, ...-0070, ...-0071, ...-0072, ...-0073, ...-0074, ...-0075, ...-0076, ...-0077, ...-0078, ...-0079, ...-0080, ...-0081, ...-0082, ...-0084, ...-0085, ...-0086, ...-0087, ...-0088, ...-0089, ...-0090, ...-0091, ...-0092, ...-0093, ...-0094, ...-0095, ...-0096, ...-0097, ...-0098, ...-0099, ...-0100

Reply Card

Please fax or e-mail this form to your Dräger representative!

D R Ä G E R	To:	< To be completed by relevant subsidiaries/dealers >	
	Department:		
	Dräger Representative		
	Fax:		
	Phone:		
	E-mail:		

Re:	Important Safety Notice on Dräger Atlan, August 2025
-----	---

C U S T O M E R D A T A	(Please complete)		
	Hospital:		
	Customer name:		
	Phone:		Fax:
	E-mail:		
	Address:		
	Address 2:		
		Country:	
	Town/city:		
	Quantity of affected units:		

☐ We acknowledge receipt of the safety notice and that the information contained therein has been brought to the attention of all affected users.

(Please complete and sign)		
Title/position:		
Name:	(Please print in capitals)	
Signature:		Date: