

URGENT IMPORTANT FIELD SAFETY NOTIFICATION

Subject:	Modulator Discharge Rod	
Product:	Digital Linear Accelerator	
Scope:	All Linear Accelerators (Synergy, Infinity, Versa HD, Elekta Evo) up to and including SN 157644 Harmony and Harmony Pro up to and including SN 451054	
Notification Released:	November 2025	
UDI Reference:	05060191071550 (NFB) Elekta Synergy 05060191071505 (FB) 05060191071543 (NFB) Elekta Infinity 05060191071512 (FB) 05060191071574 (NFB) Versa HD 05060191071529 (FB) 05060191071581 Harmony 05060191071604 Harmony Pro 07340201503461 Elekta Evo	

Description of Problem:

Defective crimping of the modulator discharge rod earth connection.

Details:

Elekta has identified a safety issue relating to the modulator discharge rod, where the supplier has been fitting the crimp in the crimp tool back to front. The issue was discovered during production.

The safety discharged rod earth lead has pulled out with ease which could lead to possible safety implications.

Not all crimps pull off easily, but stock has been found with crimps fitted in reverse.



Figure 1 - Reverse Crimping

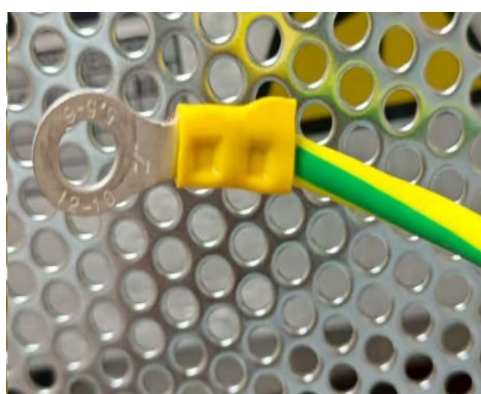


Figure 2 – Wrong Crimping

URGENT

IMPORTANT FIELD SAFETY NOTIFICATION

Clinical Impact:

The issue has no effect on clinical treatment. There is no clinical impact on the clinical user or patient.

The discharge rod is used by Field Service Engineers (FSE) when completing service activities on the machine around the HT and RF (High Tension (high voltage) and Radio Frequency) assembly.

Possible impact on the Field Service Engineer:- The FSE uses the HT discharge rod to fully discharge the voltage capacitor. Once the FSE has completed the procedure using the discharge rod, the FSE will start to work on the system around the HT and RF assembly. If the discharge rod is not fully connected to the ground or not connected at all, the system will still be fully charged and the FSE could receive an electric shock.

Recommended User Action:

No actions are required to be taken by the Clinical user.

This document contains important information for the continued safe and proper use of your equipment.

- Please post this notice in a place accessible to all users, e.g. Instructions for Use, until this action is closed.
- Advise the appropriate personnel working with this product, on the content of this letter.

Elekta Corrective Actions:

Elekta will release an Important Field Safety Modification (IFSM) to identify potentially faulty discharge rod crimping and provide further instructions. The IFSM will include procedures for verifying the reliability of the discharge rod crimping and replacing affected components if necessary

Your local Elekta service representative will contact you to arrange for this activity to be completed.

This notice has been submitted to the appropriate Regulatory Authorities.

We sincerely apologize for any inconvenience this action may cause and thank you in advance for your cooperation.

URGENT

IMPORTANT FIELD SAFETY NOTIFICATION

Acknowledgement Form

In order to meet regulatory requirements, you are required to either acknowledge receipt of this notification via the [Elekta Care™ Community](#) or complete this form and return it to Elekta immediately upon receipt, but no later than within 30 days.

Classification: Important Field Safety Notification	FCO Reference Number: 200-01-103-089
Description Modulator Discharge Rod	

Hospital:	
Device Serial No(s): (if applicable)	Location or Site:

I acknowledge that I have read and understood this Notice and accept the implementation of any given recommendation.	
Name:	Title:
Customer Signature:	Date:

New installation confirmation to be signed by the installing Elekta engineer or a Representative employee, when the installed product has a physical IFU/manual:	
I acknowledge that the customer has been informed of the content of this notice and that it has been inserted into the applicable copy of the User Manual, or added on record with the applicable User Manual:	
Name:	Title:
Signature:	Date: